


Camera Health Report

Dowanhill Medical Center

Report Generated: August 26, 2026

Filtered by labels: Export

Total evaluations	Average Score	Highest Risk	Recently Degraded
6 of 6 cameras	2.9	6	2

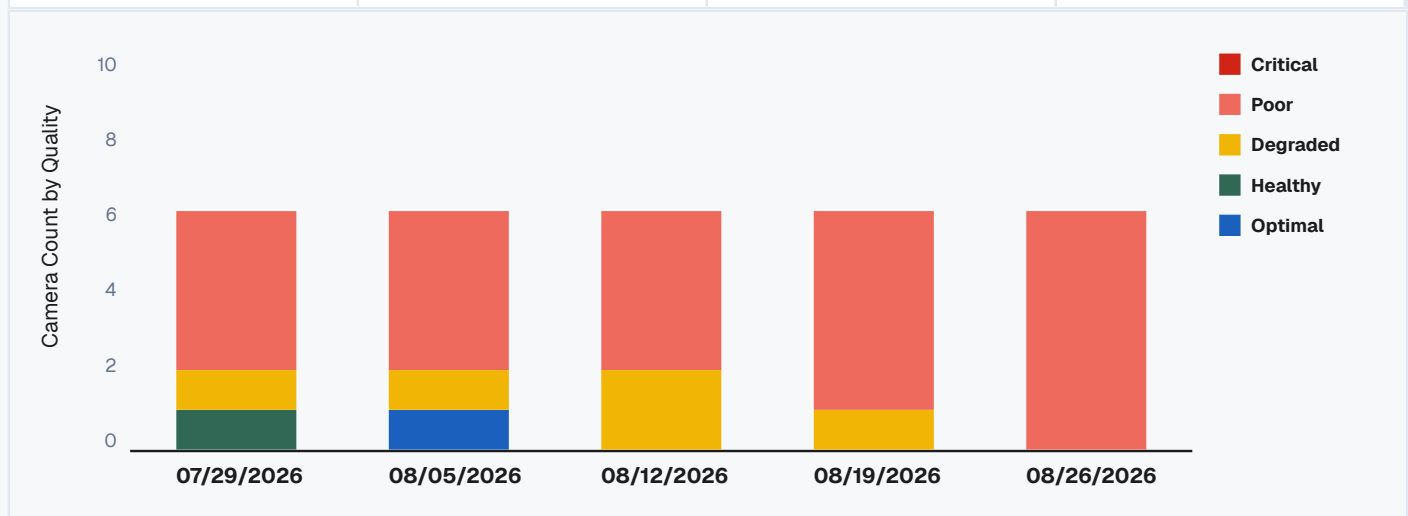

08/26/2026: (0) Optimal, (0) Healthy, (0) Degraded, (6) Poor, (0) Critical

High Risk Cameras

Camera evaluations with a score less than 3

6 cameras included in report

Byres Road Clinic

5 cameras



Byres Road Clinic - GD NJB Sign SE (W) 733

Evaluated on: 8/24/26 • IP address: – • Resolution: 2592x1944

Score: 2.8

Dome Haze Outdoor Low Light Landscape

The image shows an outdoor sidewalk scene under low light conditions, with a building on the right and streetlights illuminating the area. There is noticeable dome haze affecting the entire frame, with a smooth gradient cloudiness spreading inward from the edges and significantly obscuring the action zone in the bottom two-thirds of the image. This degradation requires a dome replacement to restore clear visibility.



Byres Road Clinic - MOB Employee Parking (10_24_5_)

Score: 2.8

Evaluated on: 8/24/26 • IP address: – • Resolution: 1920x1080

Recently Degraded

Occlusion Vegetation

Outdoor

Uniform

Landscape

The image shows an outdoor scene of a parking lot and surrounding greenery under uniform lighting in landscape orientation. Large palm fronds and branches extend into the bottom two-thirds of the frame, partially obscuring the view and reducing visibility in the action zone. This occlusion by vegetation requires on-site clearance to restore full camera coverage, resulting in a total quality score of 2.82/5.0.



MLT 004(3)

Score: 2.9

Evaluated on: 8/24/26 • IP address: – • Resolution: 2048x1536

Dome Dust

Outdoor

Ir Illuminated

Landscape

The image shows an outdoor scene at night under IR illumination, capturing a sidewalk area with bollards and a parking lot. The image quality is degraded by dome dust, visible as numerous bright circular spots scattered across the frame, which significantly reduces clarity in the action zone (bottom two-thirds). This defect results in a total score of 2.86/5.0 and requires technician intervention to clean or replace the dome.



PSQ-GD Main Lobby - 802

Score: 2.9

Evaluated on: 8/24/26 • IP address: – • Resolution: 1920x1080


Image Rotation

Indoor

Mixed

Portrait

The image shows an indoor scene with mixed lighting, captured in portrait orientation but displayed upside-down, resulting in the ceiling and upper walls appearing at the bottom of the frame. This incorrect image rotation significantly impacts the usability of the action zone in the bottom two-thirds of the frame, scoring 2.90/5.0. The issue is settings-addressable and can be corrected remotely by adjusting the camera's image rotation settings.

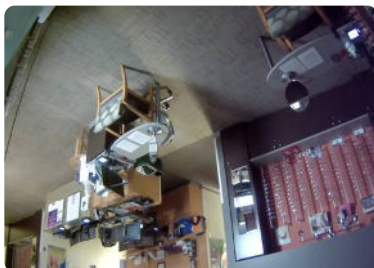

NJB Eyes on James Lobby 730

Score: 2.9

Evaluated on: 8/24/26 • IP address: – • Resolution: 1920x1080

Image Rotation

Indoor

Mixed

Landscape

The image shows an indoor retail environment with mixed lighting, capturing a display area and seating arrangement in landscape orientation. The frame is incorrectly rotated, causing the scene to appear upside-down, which affects the usability of the action zone in the bottom two-thirds of the frame. This issue is settings-addressable and can be corrected remotely to restore proper image orientation.

Kelvin Imaging Centre

1 camera



SFX MRI Outside (10_16_28_46)

Evaluated on: 8/24/26 • IP address: – • Resolution: 1920x1080

Score: 2.8

Dome Haze

Outdoor

Uniform

Landscape

The image shows an outdoor parking lot with multiple vehicles parked in rows under uniform lighting in a landscape orientation. The image quality is significantly degraded by dome haze, which causes a smooth gradient cloudiness spreading inward from the edges and obscures details in the action zone (bottom two-thirds of the frame). This defect results in a low total score of 2.82/5.0 and indicates that the dome cover should be replaced to restore clear visibility.